

Technical Bulletin

Place a copy of this bulletin in the front of each Blueprints Manual. Redline drawings as needed and include a TB reference note. Reference TB implementation on site Action Item Box-chart and/or site tool history management log.

 Number:
 022

 Date Issued:
 08/26/03

 Expiration Date:
 08/26/04

Subject/Key Words:	Low temperature filter housing mounting bracket upgrade kit
Classification:	■ Informational □ Mandatory □ Safety Alert □ PM Impact
	□ Warranty Impact □ Purchase Parts □ No Charge For Parts expires// Reference this TB# when ordering NC parts.
Applicable Akrion Procedures:	none
Parts/Reference Documents:	224375-001 universal filter housing mounting bracket field upgrade kit. (All ECTFE materials)
Attachments:	Diagram – see page 2.

Issue: All low temperature single and dual filter housing assemblies are mounted with four

screws per bowl - affixed to a tapped mounting plate which is in turn welded to a plenum side-wall supporting bracket. Reported field data has shown that some, not

100%, of the filter housing mounting plate-to-bracket welds have cracked.

Symptoms: Filter housings able to move (detached) with respect to the side-wall bracket(s).

Test/Validate: Inspect all filter housing mounts for secure welds. Plates that are not completely

separated but can "hinge" back towards the plenum wall should be upgraded.

Solution: Replace bracket as needed (one per housing): Drain, flush, and remove filter

assembly as needed. Remove original mounting plate, scrape/deburr old weld buildup flush, slide new mounting plate onto support bracket (slope side towards the wall), position and secure with the three screws. Re-install filter housing

assembly and test for leaks.

As part of CIP, gussets have been added to new manufactured filter housing mounting assemblies. Refer to page 2 for a diagram of the upgrade kit application.

TB 22 - Attachment page 2.



